



Firmware Updates Information 16.12.2012

Note: This Firmware Updates Information has reverse order - the latest update is listed first

Version 2.86 – published 16.12.2012


- changes required by new electronic board (machine with serial number 5028 or higher)
- corrected minor issue with club or spade recognition for jumbo cards (exist in version 2.78)
- improved recognition clubs and spades for cards with outside frames.

Version 2.78 – published 12.07.2012

- Corrected problem with club recognition for Japan Nintendo Cards:



- added recognition of unusual diamond suit for DESJGN cards:

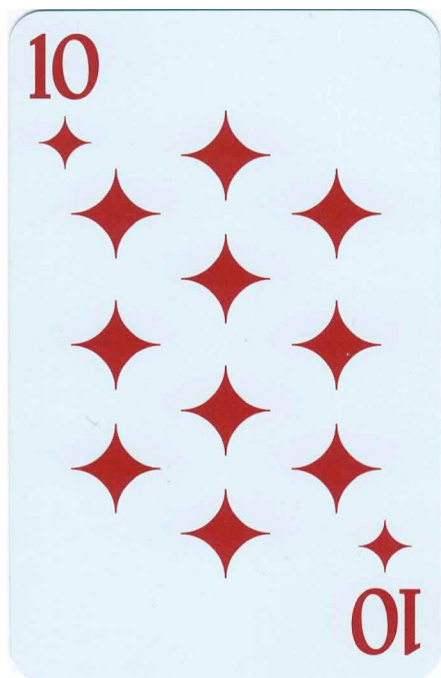

NOTE: these cards require to change MAX SYMBOL X value from typical 64 to 75.

Version 2.76 – published 01.04.2012

- Improved recognition of the cards with outside frames when clubs and spades suits symbols have fine lines (French FFB cards)

Version 2.74 – published 15.01.2012


- Fixed a bug exist in version 2.66 and 2.68 which causing recognize error for French aces (1RDV cards)
- Added possibility of using Board Number Bar-coded Labels as Board Switch (Required PC software version 4.40 or later).

Version 2.68 – published 05.11.2011

- Improved histogram procedure

Version 2.66 – published 26.11.2011

- Improved algorithm for cards with outside frame
- Changed recognition algorithm for cards when card index touches inside frame

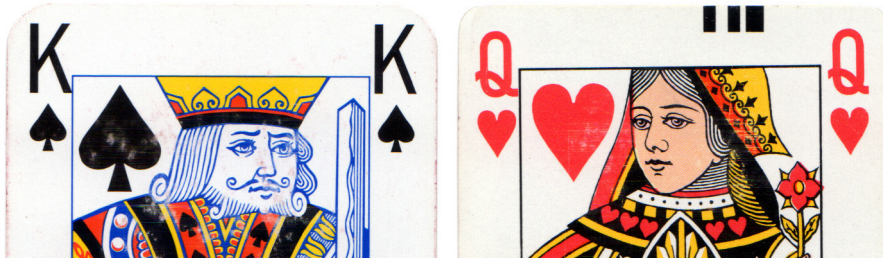

- Added recognition of cards where outside frame touches the suit symbol (French Ecole de Bridge cards)



- Added recognition of cards where something touches the suit symbol from bottom (French Societe Generale cards)



- Changed algorithm to recognize diamond suit to make it more robust.

Version 2.64 – published 04.09.2011

- Minor corrections

Version 2.62 – published 20.08.2011

- Fixed a bug in versions 2.56, 2.58 and 2.60 which may cause “Card Recognize Error” or “Duplicate Card Error” specially for older machines. It is recommended for everybody using above versions to update.

Version 2.60 – published 05.08.2011

- Corrected recognition of 7s with serif to eliminate mistakes with 2s
- Improved recognition when something is touching the symbol from the right
- Improved recognition of spade and clubs for cards with very small print

Version 2.58 – published 16.06.2011

- Improved automatic camera adjustment to make it less sensitive to external light
- Improved recognition of cards with outside frame
- Added recognition of French Bridge Diffusion cards with symbol touching or too close to the suit:



Version 2.56 – published 29.04.2011

- Minor correction with 10 recognition

Version 2.54 – published 09.04.2011

- Fixed problem with duplicate card on Kings for certain types of cards

Version 2.52 – published 13.02.2011


- Fixed problem with Error 43 happened during queen recognition for certain types of cards

Version 2.50 – published 27.10.2010 (Includes changes in earlier versions 2.42 – 2.48)

- Corrected recognize cards when something is touching the symbol on the right side:



- Added recognition of 10 with very close 1 to 0:

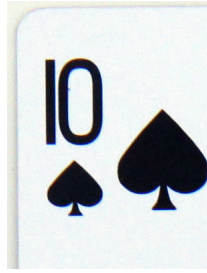

- Added recognition of the following shape of 6 and 9 and a narrow J:



- Switched off illumination LEDs when cards are not in the feeder.
- Fixed problem with Q and 10 recognition which was causing "Duplicate Card Error"

Version 2.40 – published 05.10.2009

- Improved reading clubs and spades with very fine print
- Added Board Reader support (required Delaer4 with serial number 4163 or higher)
- added Jumbo Card reading (required Dealer4 with serial number 4218 or higher)

Version 2.36 – published 23.10.2008

- Improved capture card picture quality
 - Sped up dealing process
 - Fixed problem with "Duplicate Card Error" which may happen for cards with orange diamond suit.
- (Please note that this version changes LED illumination behavior which are now on all the time during dealing).

Version 2.32 – published 07.08.2008

- added Danish cards (requires PC Software version 4.22 or later)

Version 2.30 – published 06.06.2008

- added French, Dutch and German cards (requires PC Software version 4.20 or later)
- Improved card recognition algorithms

\Version 2.26 – published 10.04.2008

- Improved recognition of cards with “grey” or “green” clubs suit symbols.

Version 2.25 – published 01.04.2008

- Fixed Gate Error (usually “Card did not go to South” or “Extra Card in South”) which may happen on the last card in a dealt board.

Version 2.24 - published 28.03.2008:

- German card support added – Dealer4 can now read German cards with AKDB symbols.
- Fixed problem with “Duplicated Card” Error which sometimes happened for no real reason.
- Allows use of Braille coded cards